

INDUSTRY GUIDELINES **POP001**

Electrofusion Jointing of PE Pipe
and Fittings for Pressure
Applications

ISSUE 8.1 / AUGUST 2021



Electrofusion Jointing of PE Pipes and Fittings for Pressure Applications

These guidelines set out the principal requirements for equipment, jointing procedures, maintenance, servicing and calibration of equipment, records and training for jointing by socket electrofusion and saddle electrofusion.

These guidelines are applicable to pipes and fittings conforming to Australian/New Zealand Standards AS/NZS 4130 and AS/NZS 4129¹.

1. GENERAL

Electrofusion fittings are currently available in the size range DN16 to DN1200. Larger sizes are under development.

The key to consistently making satisfactory joints is to follow the jointing procedure with particular emphasis on pipe surface preparation, avoidance of contamination, machine calibration, as well as temperature monitoring and control.

Pipes and fittings of different SDR can be joined together by the electrofusion process, e.g. DN250 SDR11 and SDR17 pipe can be successfully electrofused using a DN250 SDR17 fitting.

Some manufacturers supply electrofusion fittings for thinner pipes, down to SDR41 whereas others limit the use of some saddle type fittings to SDR11 or thicker. These limitations are usually detailed on the fitting body or on the packaging. If in doubt, check with the supplier or manufacturer, as unsatisfactory joints are likely to occur if the fitting/pipe combination is incorrect.

Pipes manufactured from different grades of PE materials (for example PE80 and PE100) can be joined successfully using electrofusion. Before welding it is important to confirm that all components have adequate nominal pressure rating for the operating conditions and the PE materials conform to AS/NZS 4131.

IMPORTANT: IN ALL CASES THE PN RATING OF THE FINAL ASSEMBLY IS THAT OF THE LOWEST RATED PIPE OR FITTING COMPONENT.

CAUTION: FIRE RISK - USING INCOMPATIBLE SDR PIPE WITH FITTINGS WILL RESULT IN A POOR WELD AND MAY CAUSE IGNITION OF THE ASSEMBLY

It is recommended to refer to the supplier or manufacturer of the electrofusion fittings for the installation instructions, as the method may be specific to the fitting.

Accurate record keeping and manual or automatic electrofusion equipment that provides good control of jointing conditions are essential.

¹ EF fittings can be used with plain wall PE non-pressure drainage pipes made to AS/NZS 4401 and AS/NZS 5065

1.1 SDR PIPE TO FITTING FUSION COMPATIBILITY

It is advised to consult the fitting supplier or manufacturer for confirmation of fusion compatibility when using fittings suitable for different SDRs.

1.2 OPERATOR TRAINING

All welding operators shall be qualified to **PMBWELD302E - Electrofusion Weld Polyethylene Pipelines** with a current license. Operators shall be experienced with the equipment and pipe sizes relevant to the work being undertaken.

Training shall be provided by Registered Training Organisations (RTO's) that are accredited by State/Territory Training Authorities under the Australian National Training Authority (ANTA) guidelines and conforming to PMB 07 Competency Standards prepared by Manufacturing Learning Australia, Qualification Framework for the plastics, rubber and cable making industry.

The RTO's providing training in all forms of welding plastics pipeline systems shall have staff qualified in presenting courses that meet competency standards covered by sections PMBWELD301E through PMBWELD311E.

The RTO's normally issue an accreditation certificate to successful candidates completing the training course and maintain a register of accredited welders.

1.3 REQUIRED EQUIPMENT

The following is a list of the minimum equipment that should be available at each electrofusion welding site.

- Diameter tape (i.e. Pi tape) – to measure average diameter in the weld zone
- Metal ruler – to measure insertion depth
- Calliper or metal rule to measure pipe ovality
- Pipe preparation and alignment equipment
- Pipe cutting – appropriate pipe cutting device to ensure pipe squareness
- Rotational peeling tool – Capable of removing a continuous ribbon of material from the pipe surface no less than 0.2mm thick per rotation.
- Micrometer or callipers for measuring peel strip thickness
- Deburring tool – tool to remove sharp edge from pipe end
- Re-rounding clamps – clamps shall ensure area in weld zone remains within roundness specification during the weld (refer to Table 4).
- Approved alcohol cleaning wipes for final surface cleaning (refer to Section 2.1.2)
- White or silver colour ink permanent marker
- Alignment clamps – clamps designed to align the pipe and fitting, preventing bending stresses on the joint assembly, thereby restraining the joint during both the welding and cooling process.

- Environment protection enclosures (e.g., tent or shade apparatus for protection against direct sunlight exposure and adverse weather conditions)
- Power supply (generator calibrated and rated as per fitting supplier specification)
- Electrofusion control unit in accordance with ISO 12176-2
- Saddle fitting mounting tool (if using "top loading" saddles).

1.4 EQUIPMENT DETAILS

1.4.1 ELECTROFUSION CONTROL UNIT

The control unit input supply should be from a nominal 240V generator suitable to drive inductive loads and phase cut systems, commonly of about 5kVA capacity. Some fitting suppliers may consider smaller capacity generators acceptable for small diameter fittings. The nominal output of the generator shall be compatible with the requirements of the control unit.

It should be noted that electrofusion control units may generate considerable heat. Refer to the supplier of the controller to ensure the unit has an integrated cooling system.

Control units should operate with barcode marked fittings according to ISO 13950, with a maximum output of 48 Volts.

Control units should include safety devices to prevent voltages greater than recommended by the manufacturer. The safety device should operate in less than 0.5 sec. Check the suitability of the control unit for use with the fitting supplier.



1.4.2 PEELING TOOLS

Mechanical or rotational peeling tools shall be capable of removing a continuous and uniform peel thickness from the outer oxidised surface, in the case of socket type fittings over the required insertion depth, and in the case of saddle fittings over the full area of the saddle base when preparing the fusion zone. Peeling tools are available in a variety of types powered by hand, electric or pneumatic mechanisms.

Mechanical peeling tool cutting blades shall be serviced and maintained regularly, or replaced as required, to ensure uniform and continuous removal of a minimum 0.20 mm PE strip thickness per pass. Blunt cutting blades reduce efficacy and furthermore can fail to remove the minimum required oxidised PE strip thickness from the pipe surface.

Mechanical peeling tools for pipe ends and mid pipe (for use with saddles) are readily available for all pipe sizes.


ROTARY PEELING TOOLS



1.4.3 ALIGNMENT CLAMPS

Electrofusion jointing generates significant melt pressure during the heat fusion cycle, produced as a result of thermal expansion, therefore alignment or resistant clamps are required to prepare a stress-free joint assembly, during both the fusion and cooling process.


Alignment clamps restrain and align the pipe within the socket, preventing misalignment and bending stresses on the joint, and subsequently reduce the annular gap between the pipe and fitting socket during the fusion and cooling cycle. Misalignment stress can result in electrofusion heating wires moving out of place during the welding cycle, resulting in overheating and uncontrolled melt flow at the joint inner or outer cold zone, as shown below.

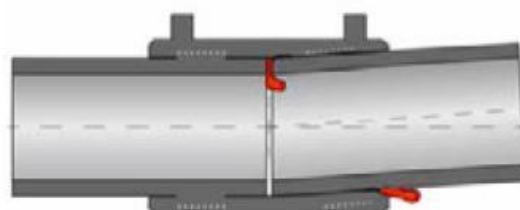

Alignment clamps shall be assembled in accordance with manufacturers instructions as incorrect assembly can result in pipe misalignment.

Benefits of Clamps

- Some clamps may simultaneously restrain and re-round pipe
- Provides correct assembly and alignment of the pipe with the fitting, including coiled pipe
- Ensures joint is stabilised during the welding heating and cooling cycle
- Helps achieve a stress free joint
- Promotes uniform melt pressure within the joint

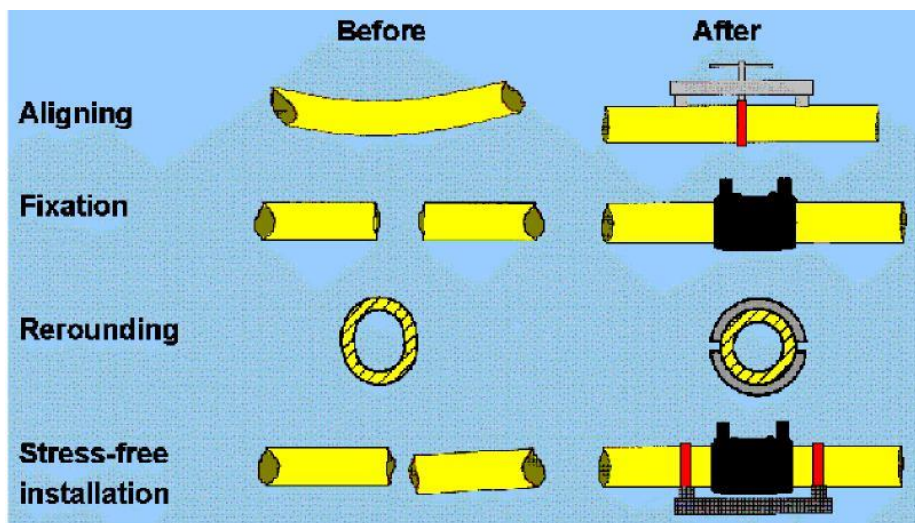


1.4.4 RE-ROUNDING CLAMPS

Re-rounding clamps should be readily available when preparing electrofusion joints and shall be used when pipe dimensions are outside the specifications stated within Table 4. Re-rounding tools shall be suitable to reduce pipe ovality in the fusion zone <3mm. Refer to Table 4 for further details.



MECHANICAL RE-ROUNDING CLAMPS

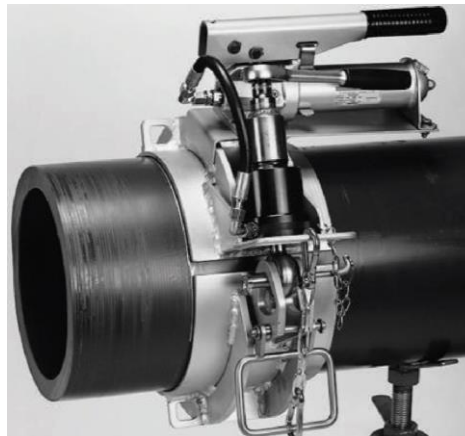

HYDRAULIC RE-ROUNDING TOOL

1.4.5 PIPE CUTTERS

Pipe cutters should include saw and saw guide.



PIPE CUTTER



MOTORISED HAND CIRCULAR SAW



GUIDED CIRCULAR SAW

2. JOINTING

Electrofusion (EF) jointing incorporates an electrical resistance element in the fitting which, when connected to an appropriate power supply, melts and fuses the materials of the pipe and fitting together.

There are two basic types of EF fittings:

1. socket type fittings (or couplers) used for joining pipes and fittings together or
2. saddle type fittings for making branch connections - there are two common variations of saddle fittings:
 - a) "Clamp type" fittings that fully encircle the pipe, where the clamp section remains on the pipe (commonly found with tapping saddles)
 - b) "Top loading type" where the EF saddle utilises a mounting tool to position the fitting during the welding process and is then removed once the welding process is complete (often used for larger off takes).

The effectiveness of EF jointing depends on attention to preparation of the jointing surfaces and the geometry of the assembly, in particular the removal of the oxidised surface of the pipe over the socket depth or saddle mounting area, ensuring the jointing surfaces are clean and free from contamination, and the assembly and clamping instructions are correctly followed.

2.1 KEY ASPECTS OF EF JOINTING


2.1.1 SURFACE PREPARATION – PEELING

Prior to peeling the pipe, thoroughly clean – removing excess dirt, mud, and other debris, allowing the mechanical peeling tool to operate smoothly against the pipe surface. Large dirt particles, sand and other abrasive debris can damage the peeling tool cutting blade causing premature wear and tear.

In order to achieve an acceptable weld, the oxidised surface of the pipe must firstly be removed, to expose clean virgin material beneath the surface. The removal of this oxidised surface layer is achieved using a mechanical peeling tool.

Surface oxidation acts as a physical barrier, inhibiting heat fusion, therefore consistent peeling to the correct depth is critical to the success of the welding process, and the only effective means of achieving this is use of a mechanical or rotational peeling tool. Only mechanical or rotational peeling tools shall be used. Hand scrapers are not mechanical peeling tools and shall not be used.

After completing the first pass with the mechanical peeler, measure the peel strip thickness of a few specimens spread evenly across the full peel width, using calipers or a micrometer gauge, ensuring the caliper jaws are closed with light gripping pressure for accurate measurement. The thickness should be measured to an accuracy of 0.01 mm. Two or more passes with the mechanical peeler may be required to ensure sufficient oxidised PE material is removed from the pipe surface, as specified in Table 2. However, the need to perform multiple passes may indicate the cutting blade requires servicing or replacement.

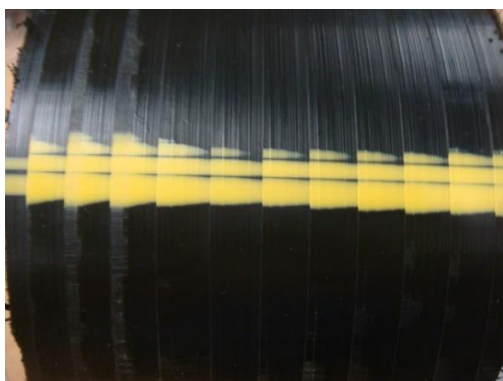

Mechanical rotary peeled pipe displaying a wedge-shaped peeling pattern along the yellow stripe, indicating the cutting blade has a blunt leading edge.

Note: The tensile strength and surface hardness of PE100 pipe is greater than that of PE80, therefore can increase the rate of wear on peeling tools blades.

Mechanical peeling of moulded PE spigot fittings may be required, dependent upon manufacturers specific recommendation, therefore refer to the fitting supplier prior to use. Where specific advice from the supplier is unavailable, peeling is recommended. Moulded spigot fittings fabricated with

welded pipe tails intended to extend the fitting length, must be mechanically peeled and prepared for electrofusion jointing in the same manner as PE pipe ends.

The following Table 2 – Pipe peel depth requirements, apply generally to both socket and saddle electrofusion jointing.

Table 2
Pipe peel depth requirements

PIPE DN	PEEL DEPTH (mm) SEE NOTE
≤DN25	0.2 Maximum
DN32 – DN63	0.2 – 0.3
DN75 – DN225	0.2 – 0.4
>DN225	0.3 – 0.5

Table 3

Minimum allowable pipe diameter after peeling

(Measured using Pi Tape at the halfway point along the fusion zone using clean equipment to avoid contamination).

PIPE DN	MINIMUM MEAN OUTSIDE DIAMETER (OD) OF PREPARED PIPE (mm)
16	15.6
20	19.6
25	24.6
32	31.5
40	39.5
50	49.5
63	62.5
75	74.4
90	89.4
110	109.4
125	124.4
140	139.4
160	159.4
180	179.4
200	199.4
225	224.4
250	249.3
280	279.3
315	314.3
355	354.2
400	399.2
450	449.2
500	499.2
560	559.2
630	629.2
710	709.2
800	799.2
900	899.2
1000	999.2
1200	1199.2

NOTE: If entry of the pipe or fitting spigot into an electrofusion coupling is still restricted after the oxidised layer has been removed, the pipe may be peeled further to the minimum permissible pipe outside diameter after peeling, as shown in Table 3. In this case, the thickness removed may be greater than that stated in Table 2.

2.1.2 SURFACE PREPARATION – APPROVED ALCOHOL CLEANING WIPES

Disposable cleaning wipes shall be formulated with alcohol solution, typically comprising of Ethanol or Iso-Propanol, producing rapid evaporation after the cleaning process.

No chemical additives such as surfactants, detergents or other cleaning agents shall be formulated into the alcohol solution. The cleaning wipe materials shall be colourless and not shed fibres or contribute any other form of contamination to the alcohol solution.

To verify the quality of the cleaning solvent, wipe a hand mirror with the cleaning wipe, visually ensuring the solvent completely evaporates without residues left behind.

Refer to the fitting supplier for recommended alcohol wipes.

2.1.3 SURFACE PREPARATION – CLEANING

The surfaces to be EF welded shall be completely clean and free of contaminants. It is essential to clean the peeled surface with unused approved alcohol wipes to remove traces of dirt, mud, and other contamination.

Do not under any circumstances use methylated spirits, acetone, methyl ethyl ketone (MEK) or other solvents to clean the fusion area.

Rags of any kind with or without any alcohol solvent are not to be used to clean the fusion area given the possibility of introducing dye, dirt, detergent, fabric conditioner or other contaminants into the fusion zone.

Other important factors relating to the use of alcohol wipes:

- Ensure wipes are saturated with alcohol i.e., have not dried out.
- When using the cleaning wipe, work from the prepared (peeled) surface towards the unprepared area and discard the wipe after it has come in contact with any unprepared areas. Wiping from unprepared areas towards the prepared surface can contaminate the fusion surface and similarly using a wipe which has been used on an unprepared surface can also introduce contaminants.

Note: Where pipe is intended for installation by horizontal directional drilling, using drilling lubricants such as Bentonite clay, particular attending to cleaning both before and after pipe peeling is necessary. Drilling lubricants, even when dried, can be very difficult to visually identify, and are easily spread by wiping.

- Only use the wipe once.
- Do not wipe over the witness mark.
- Do not touch the prepared pipe surface with bare or contaminated hands – sweat, sunscreen, barrier cream, soap, detergent, dirt, and skin oils are all potential sources of contamination.

Disposable latex or nitrile powder free gloves are recommended when handling the wipes for preparation of the surface.

- Ensure alcohol left by the wipe on the cleaned surface has fully evaporated and the prepared surfaces are completely dry before assembling the joint.
- Ensure that any part of the wipe that is in contact with the welder's hand does not make contact with the joint surface.

2.1.4 MARKING

Marking of the pipe is necessary to define the areas to be peeled and also to mark the extent of insertion of socket type fittings.

Prior to peeling the pipe shall be marked to identify the extent of the area to be peeled. This mark should extend beyond the socket entry depth for couplers or beyond the extent of the saddle weld area by approximately 20mm.

In the case of socket type fittings – For fittings designed with or without centre stops, insertion depth should be clearly marked on the pipe ends, after the pipe surface has been prepared and cleaned for jointing.

The insertion depth should be marked at intervals around the circumference of the pipe using white or silver colour ink permanent marker and be square with the pipe axis to assist the operator in determining if the assembly is correctly aligned prior to commencing welding, thereby ensuring the correct insertion depth and the pipe has not moved at any point during the welding process.

2.1.5 SURFACE CONTAMINATION

EF fitting welding surface shall be clean and free of contaminants. Common sources of contamination include dirt, dust, sand, grease, hand cream, sunscreen, detergent, and surfactant used in horizontal directional drilling, such as Bentonite clay. Welders shall ensure hands are free of potential contaminants and should wear disposable nitrile gloves when handling jointing components. In addition, equipment should be clean and in good condition.

In addition to avoiding contamination of the jointing surfaces, clean the pipe surface with a new approved alcohol wipes to remove traces of dirt, mud and other contamination.

When using slip couplings clean the entire area where the fitting will pass over the pipe.

The area of the pipe to be fusion jointed may be washed with clean water if necessary and dried with lint free material prior to peeling. Ensure the fusion area is completely dry before proceeding. Do not use detergent or surfactants to clean pipe surfaces.

NOTE: Refer to fitting supplier for recommended alcohol wipes. Kitchen/bathroom and/or personal cleaning wipes may contain lanolin and/or detergent which will contaminate the pipe surface and therefore are not suitable for electrofusion jointing procedures.

2.1.6 SITE AND WEATHER CONDITIONS

Suitable shelter should be used to provide shade and protection for the pipe, fittings and equipment against adverse weather conditions (such as extremes of temperature, high winds, rain etc) and

contamination of the jointing surfaces by dust and/or moisture, which can result in unsatisfactory joints.

Pipe and fittings, if left in direct sunlight, absorb heat and can become very hot which may affect the fusion welding. When jointing in high ambient temperature and in combination with direct sunlight, it is important that the pipe jointing area is shaded by an appropriate shelter. Shading could take the form of a thermal blanket, light coloured plastic sheet (do not use a dark coloured sheet) or a shade structure of some sort. The aim of shading is to bring the pipe and fittings to an even temperature at or close to the ambient temperature. Some fittings do not require adjustment to the heat cycle time for ambient temperatures in the range - 10°C to +45°C, whereas others require heat cycle time variation. Some manufacturers electrofusion control units are designed with temperature compensation sensors that adjust the heat weld cycle time, based on the ambient temperature, within operating range -10°C to +45°C.

Ensure there is sufficient space to permit access to the jointing area. In a trench, a minimum clearance of 150 mm is required all round the pipe. Larger clearances may be needed for large nominal pipe sizes, depending on the tool used.


Fittings should only be removed from their original packaging immediately before using for jointing.

2.1.7 DIMENSIONAL, GEOMETRY AND OTHER CONSIDERATIONS

All pipes need to be checked for damage, dimensional conformance, and geometry considerations such as reversion, end squareness and ovality.

2.1.7.1 CIRCUMFERENTIAL REVERSION

PE pipes often exhibit circumferential “reversion” (i.e., toe-in, barrelling) at pipe ends (as shown in the diagram below). As the pipe exits the extrusion machine at manufacturer, the pipe outer surface cools more quickly than the inside of the pipe, creating a stress in the pipe wall, causing the pipe ends to sink inwards. The occurrence of reversion increases with the pipe diameter. Excessive reversion can negatively affect electrofusion welds by creating an excessive gap between the socket and pipe wall, prompting inadequate fusion between the pipe and coupler, as well as melt extrudate during fusion welding.

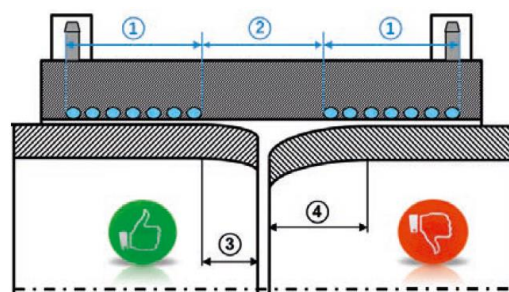

1. Fusion heating zone
2. Cold Zone
3. Acceptable pipe end reversion
4. Unacceptable pipe end reversion

Installers can determine if end reversion is acceptable by measuring the pipe end diameter using Pi tape, making the following calculation:

Prior to peeling, measure a distance $DN \times 5\%$ from the pipe end. At this point the OD should be no less than the DN.

E.g. – When checking end reversion on a DN500 PE pipe end: $500\text{mm} \times .05 = 25\text{mm}$. At a distance 25mm from the pipe end, the OD of the pipe should be no less than 500mm.

If the OD is less than 500mm, the pipe should be squarely cut at a position 25mm from the end.

In addition, visually checking the pipe ends with a spirit level, can be utilised.

Note: The residual stress in the pipe wall is not limited to the pipe ends and occurs throughout the pipe length, therefore reversion can reoccur in freshly cut pipe ends, sometimes within hours. Therefore, electrofusion jointing should be completed as soon as possible following pipe preparation.

2.1.7.2 OVALITY



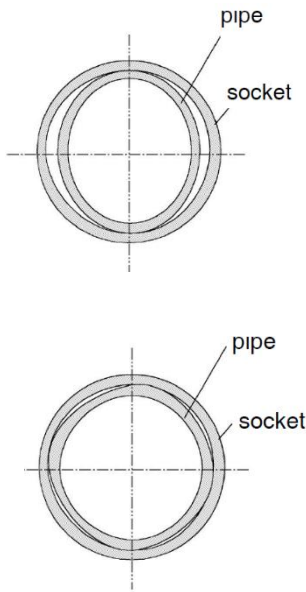
Pipe shall be checked for out-of-roundness (ovality). Some pipes may be too oval to fit into electrofusion sockets or exceed the ovality tolerance for saddle type fittings and shall be re-rounded with rounding tools or clamps. Re-rounding clamps shall ensure that the pipe diameter in the fusion zone is re-rounded, and the clamp assembly maintained in place during the welding and cooling phase. Where the pipe cannot be re-rounded within the acceptance criteria, or has excessive flat spots present on the outer surface ($>3\text{mm}$), other methods may be applied such as butt-welding short pipe lengths to the end of the out of round pipe to allow conformity with the acceptance criteria.

Check ovality as described in Table 4 and use re-rounding tools as appropriate.



PIPE OVALITY GAUGE

Table 4
Ovality and Flat Spots

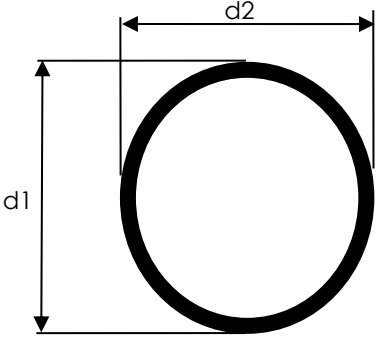
WELD FEATURE	COMMENTS	ACCEPTANCE CRITERIA
<p>1. PIPE OVALITY</p>  <p>d1 = maximum OD of pipe d2 = minimum OD of pipe</p> <p>2. PIPE FLAT SPOTS</p> 	<p>This deformation may cause an excessive gap between the pipe and the EF fitting. This gap can be tolerated up to a certain limit.</p> <p>EXAMPLES</p> 	<p>Pipe ovality at fusion zone area prior to welding.</p> <p>Pipe DN < 315</p> <p>$d1 - d2 < 1.5\% \text{ DN or } 3 \text{ mm}$ (whichever is the smallest value.)</p> <p>Pipe DN ≥ 315</p> <p>$d1 - d2 \leq 1\% \text{ DN or } 5 \text{ mm}$ (whichever is the smallest value.)</p> <p>Measuring pipe flat spots Following pipe re-rounding, accurately measure the flat post depth using a pipe ovality gauge, intersected with a steel ruler.</p> <p>Flat spot depth $\leq 3\text{mm}$</p> <p>Guidance on minimum pipe diameter after peeling is provided in Table 3.</p> <p>Note: where pipe cannot be re-rounded within the acceptance criteria, other methods may be applied such as butt welding pipe tails to allow compliance</p>

2.1.7.3 SURFACE DAMAGE

- After mechanical peeling, visually inspect the pipe surface prior to assembly of the electrofusion joint.
- Examine for scores or deep gouges that weren't removed by peeling.
Note: remaining surface irregularities can cause problems in the electrofusion heat zone (i.e., melt pressure imbalance during welding, electrical short circuit, incomplete welds, or voids in the fusion zone).
- If gouges remain on the surface - peel again to remove them, ensuring the pipe diameter complies with Table 3 (Min pipe diameter after peeling).
- Where gouges cannot be removed by peeling, don't proceed with the assembly of the electrofusion joint.

2.1.7.4 END SQUARENESS

Pipe ends shall be cut square with an appropriate pipe cutting tool, ensuring the electrofusion fitting heating zone makes positive contact with the pipe surface.

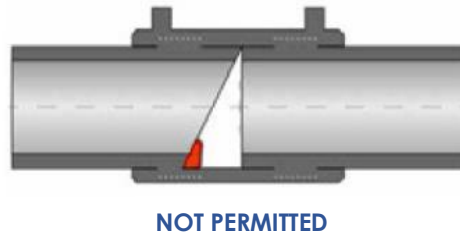

3. POST WELD VISUAL INDICATORS

Some fittings are equipped with fusion indicators. Fusion indicators may be in the form of pins which rise, or a coloured disc which changes colour upon completion of the fusion cycle.

In the case of pin type indicators, they indicate that the fusion melt pressure has been achieved. The height of the extended pin is dependent upon the fitting in use, component tolerances and pipe material.

In the case of the coloured disc, they indicate the melt temperature has been achieved.

Indicators do not guarantee the quality of the joint.

The indicators are used to highlight if a more detailed inspection of the joint is required. In the event that the pin does not rise, or the colour has not changed on the disc, the supervisor or operator shall investigate the following to determine if the joint is satisfactory by confirming all the following features are within specification:

- Dimensional check and conformity of the pipe spigot OD and ovality
- The pipe dimension within the fusion zone shall conform to Table 3 (min allowable pipe diameter after peeling).
- The input power supply to the electrofusion control unit is stable without disruption, particularly electrical generators, and no error messages are reported on the display panel. Do not connect additional devices to the electrical generator during electrofusion welding.
- Ensure electrical generators have sufficient power output for the respective fitting diameter. Typically, generators with a minimum power output of 5kVa are required for most electrofusion fittings, however, refer to the fitting manufacturer for further details about the necessary power requirements.
- That the heat fusion parameters are correct.
- The pipe to fitting alignment is correct with no visible plastic extruded out from the fitting.

4. MAINTENANCE, SERVICING AND CALIBRATION

All equipment should be well maintained and kept in a clean condition at all times.

The equipment should be serviced and calibrated regularly. The frequency at which this is carried out will be different for individual items of equipment and will also depend on usage but should be at least once every 12 months. Guidance should be sought from the equipment manufacturer and a scheme of calibration and servicing implemented. Particular attention should be given to the Electrofusion control unit, the electrical generator, and the peeling tools. The sharpness of tool cutting blades should be checked at least on a weekly basis and the peel depth should be measured regularly with a calliper to check it is at least 0.2mm.

Note: Electrofusion control units rely upon uniform and stable input power supply, therefore particular attention to regular service/calibration of electrical generators should be highlighted. Poorly maintained generators can potentially overload the Electrofusion control unit power filter, causing the machine to fail. Refer to the generator supplier for further details.

5. RECORDS

5.1 JOB SUPERVISION

Electronic or written records of the fusion procedure for each joint should be kept as required.

5.2 EQUIPMENT SERVICING AND CALIBRATION

Electronic or written records of appropriate servicing and calibration should be kept. The minimum information to be recorded is given in Appendix A.

6. JOINTING PROCEDURE - SOCKET TYPE FITTINGS

1. Ensure hands and tools are free from potential contaminants (refer to 2.1.4 above). Check equipment is complete, clean, calibrated, undamaged, in working order and protected by shelter.
2. Assess the dimensional aspects of the pipe – ovality, reversion, diameter, end squareness etc. Use re-rounding clamps if necessary. Check that the pipe ends to be jointed are cut square to the axis and any burrs and swarf are removed and chamfer the leading edge to remove sharp edges.
3. Assess the site and weather conditions. Ensure shading and protection from dust, wind, rain etc. For installations in a trench or restricted space ensure sufficient room is available.
4. Assess pipe cleanliness - If necessary, remove any dirt or other contaminants from the pipe surface using only clean water prior to peeling. Wipe the area to be peeled using approved alcohol wipes. Ensure pipe is completely dry before commencing peeling operation.
5. With the fittings still in the bag, place alongside the pipe end and put a witness mark on the pipe at half the fitting length plus about 20 mm to enable visual checking of the peeled area after jointing.

NOTE: Do not remove the fitting from its packaging at this stage.

6. Using an appropriate peeling tool, remove the entire surface of the pipe to the depth of the witness mark. **Metal files, rasps, emery paper etc are not suitable preparation tools and shall**

not be used. Measure the peel strip with a calliper to ensure removal of the correct peel depth. Refer to Table 2 and 3 above.

NOTE: More than one pass may be required to achieve the correct peel depth.

7. Wipe the prepared pipe surface only with a recommended alcohol wipe to remove any dust residue and other contaminants. For larger diameter pipes use multiple alcohol wipes.

NOTE: Cleaning of the prepared surface is a critical step and one that has the potential to introduce contaminants if not done correctly – remember this is the surface that is about to be welded and the presence of contaminants will result in a poorly welded joint. To avoid contamination, **ONLY** wipe the peeled fusion zone area.


Do not under any circumstances use methylated spirits, acetone, methyl ethyl ketone (MEK) or other solvents to clean the fusion area. Rags of any kind with or without any alcohol solvent are not to be used to clean the fusion area given the possibility of introducing dye, dirt, detergent, fabric conditioner or other contaminants into the fusion zone.

Other important factors relating to this procedure:

- Ensure wipes are saturated with alcohol i.e., have not dried out.
- When using the wipe work from the prepared (peeled) surface towards the unprepared area and discard the wipe after it has come in contact with any unprepared areas. Wiping from unprepared areas towards the prepared surface can contaminate the fusion surface and similarly using a wipe which has been used on an unprepared can also introduce contaminants.
- Only use the wipe once.
- Do not wipe over the witness mark.
- Do not touch the prepared pipe surface with bare hands – sweat, sunscreen, barrier cream, soap, detergent, dirt, and skin oils are all potential sources of contamination. Disposable latex or nitrile powder free gloves are recommended when handling the wipes for preparation of the surface.
- Ensure alcohol left by the wipe on the cleaned surface has evaporated and the prepared surfaces are completely dry before assembling the joint.
- Ensure that any part of the wipe that is in contact with the welder's hand does not make contact with the joint surface.

Refer to the electrofusion fitting supplier for the correct selection of alcohol wipes.

ENSURE THE PREPARED SURFACES ARE COMPLETELY DRY BEFORE PROCEEDING

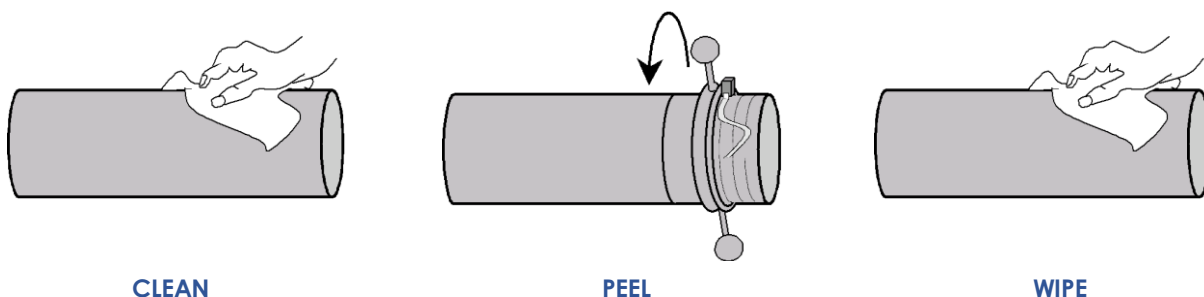


DO NOT HANDLE THE PREPARED PIPE SURFACE

8. Remove the fitting from its packaging and check that the bore of the fitting is clean. The bore of the fitting may be wiped with an approved alcohol wipe if necessary.

NOTE: Ensure the cleaned bore is completely dry before proceeding.

9. Inscribe an accurate witness mark at intervals around the circumference of the pipe or insertion depth onto the pipe and then insert the pipe ends into the fitting so that they are in contact with the centre stop and witness mark. It is critical that the pipe be fully inserted, particularly for larger pipes or when there is no centre stop. Ensure an aligned pipe arrangement in order to avoid any stress during the jointing process, especially when using coiled pipes.

The pipe end(s) and the fitting shall be correctly aligned and free of any bending stress. Use pipe clamps, or other suitable means, to secure the pipe(s) so they cannot move and ensure that the fitting is satisfactorily supported to prevent it sagging during the fusion procedure. Large bore fittings \geq DN280 should be secured with slings or other suitable means e.g., clamps, prior to electrofusion welding. Check that the pipe clamps are of the correct size for the pipes to be jointed. Only use the correct size pipe clamps. Check that the alignment clamps have been assembled in accordance with the manufacturer's instructions and that, after tightening, the pipes are correctly aligned. Note that pipe misalignment can be created if clamps are not assembled symmetrically. Refer for POP014 for alignment guidelines.

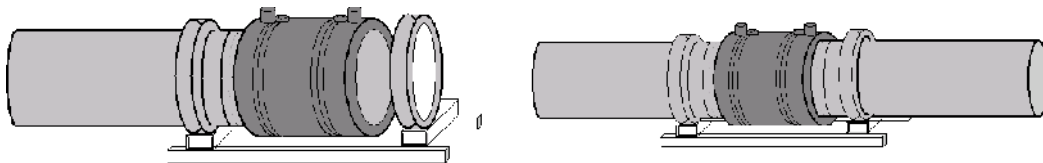

10. Check that there is sufficient fuel for the generator to complete the joint. Start the generator and check that it is functioning correctly.


NOTE: Ensure the generator is switched on and running satisfactorily before connecting the electrofusion control unit to the power source.

11. Switch on the control unit. Check that the reset button, if fitted, is in the correct mode.
12. Connect the control unit output leads to the fitting terminals and check that they have been fully inserted.
13. The jointing time is generally indicated either on the fitting or on a data carrier supplied with the fitting. Check that the correct time is shown on the control unit display. If required for the control unit, enter the fusion jointing time and voltage into the control unit timer.


NOTE: Automatic control units are available which obviate the need to enter the fusion time.

14. **NOTE:** Some fitting manufacturers only allow weld parameters to be entered via scanning the fitting barcode – check with the fitting supplier.

15. Most control units are equipped with a barcode reader or barcode scanner. Scan the fusion data barcode into the machine to ensure a fully automated and controlled data entry. Barcode reading control units automatically adjust for variable temperature conditions. For manual input of the heat fusion time into the control unit, refer to the manufacturer's parameters, supplied with the fitting.

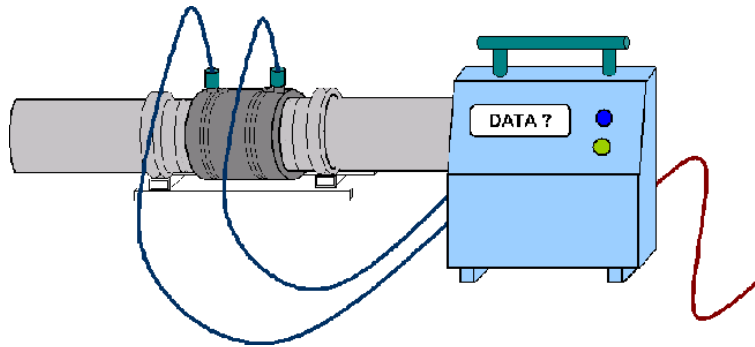

16. Press the start button on the control unit and check that the heating cycle is proceeding as indicated by the display.
17. On completion of the heating cycle, both melt indicators within the processed part of the fitting should have risen. If there is no apparent movement of either indicator the joint could be unsatisfactory – refer to discussion on electrofusion indicator pins in Section 3.

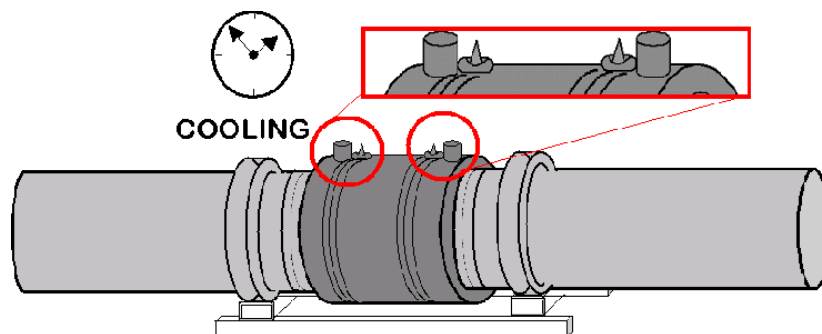

18. If the fusion cycle terminates before completion of the countdown, check for faults as indicated by the control unit warning lights or display. Check for a possible cause of the break, e.g., inadequate fuel in the generator, or power supply failure, etc.

NOTE: Do not attempt a second fusion cycle until the entire fitting has cooled to less than 45° C. Some manufacturers recommend replacement of the fitting rather than a second fusion cycle. Refer to the fitting manufacturer for details.

The completed joint shall be left in the clamps for cooling. The time needed will be specified on the fitting, or by its data carrier, or in the display of the automatic control unit.

19. When the joint has cooled, remove it from the clamps and inspect. The fitting may require a longer cooling time prior to pressure being applied to the joint – refer to the manufacturer for details.

6.1 ELECTROFUSION SLIP COUPLING ASSEMBLY


When using slip couplings in addition to the steps above the following important steps shall also be taken into consideration:

1. The pipe end where the coupler is inserted shall be peeled the full coupling length, plus a minimum of 20 mm.
2. Ensure witness marking is beyond the slip pipe surface, where the coupler is inserted, to prevent contamination of the fusion zone.
3. If necessary, remove re-rounding clamps progressively along pipe to retain correct ovality and to facilitate coupler insertion. Progressively clean pipe surface as re-rounding clamps are moved to ensure a clean surface for coupler to be inserted.
4. Insert the full coupler over the slip pipe end and apply a witness mark (A) at the end of the fitting.
5. Apply a witness mark (C) on the pipe to be installed, measuring exactly 50% of the full coupler length.
6. Bring both squarely cut pipe ends together.
7. Push the coupler fitting onto the butted pipe until the coupler end meets the witness mark (C) on the new installed pipe.
8. Measure the distance (X) between (A) and the fitting end on the slip pipe (B). Distance X should = $L/2$ (Where L = the coupler total length) If X is $> L/2$ then the pipe ends are not fully abutted. Rectify abutment by bringing pipes ends together.

This procedure ensures witness marking and other contamination is not introduced into the fusion area, along the coupler slip path.

Refer to Diagram 1 for marking configuration and further details.

Diagram 1
Electrofusion Slip Coupler Installation

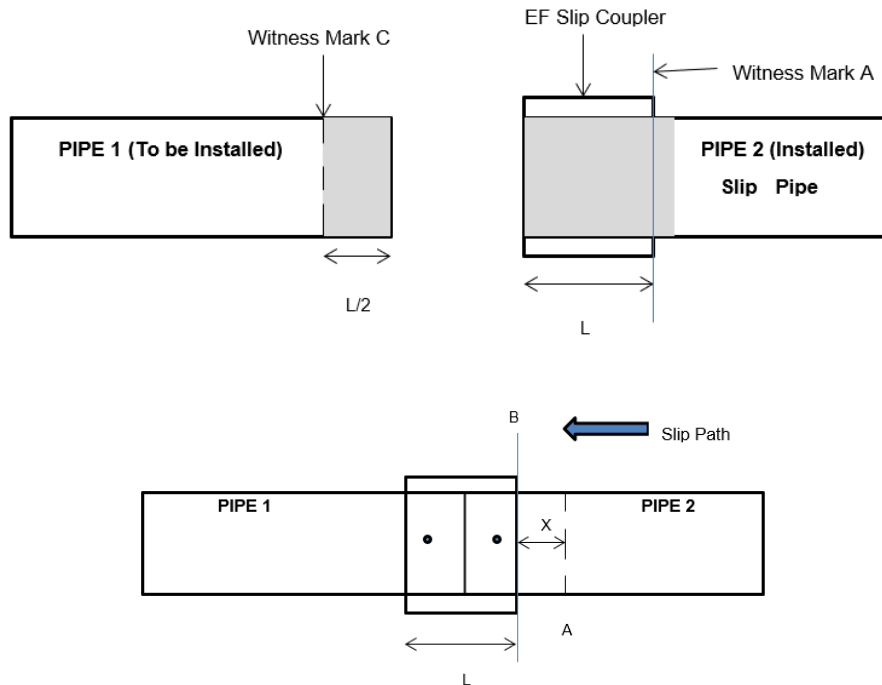

Peeled Area

L= Total Coupler Length

A= Witness Mark

B= Witness Mark (measured after slip procedure)

C= Witness Mark

$X = L/2$

Measure the distance between A and B = X

If $X > L/2$ the pipes ends have NOT made contact with each other or abutted together, therefore forming a gap in the centre of the electrofusion coupler.

Rectify abutment by bringing pipes together.

7. JOINTING PROCEDURE – CLAMP TYPE ELECTROFUSION SADDLE

Clamp type electrofusion saddles are available to fit all commonly used main sizes from DN40 to DN2000 with a large range of outlet sizes.

NOTE: Some saddle type fittings are limited to SDR11. Refer to the fitting manufacturer for further details.

Saddles are usually supplied complete with the manufacturer's recommended installation procedure.

1. The nominal pipe diameter shall be within the tolerances specified in AS/NZS 4130. Re-rounding clamps may be required if ovality exceeds AS/NZS 4130 – refer to fitting's supplier for allowable ovality tolerance.
2. A pipe clamp of suitable dimensions for making the service or branch connection is needed.
3. Suitable shelter should be used to provide shade and protection for the pipe, fittings, and equipment against adverse weather conditions (such as extremes of temperature, high winds, rain etc) and contamination of the jointing surfaces by dust and/or moisture, which can result in unsatisfactory joints. Fittings should only be removed from their original packaging immediately before using for jointing.

7.1 ELECTROFUSION SADDLE JOINTING METHOD

7.1.1 PREPARATION

1. Ensure hands and tools are free from surface contaminants, such as barrier hand cream, sunscreen, detergent, and surfactant used in horizontal directional drilling.
2. Expose the pipe onto which the saddle is to be assembled, ensuring there is clear space around the pipe. In a trench a minimum clearance of 150mm is required all round. Larger clearances may be needed for larger nominal sizes, depending on the tool used.
3. Wipe the joint area, where the saddle is to be fitted, with alcohol wipes to remove traces of dirt, mud and other contamination. The joint area may be washed with clean water if necessary and dried with lint free material prior to peeling. Ensure the joint surface is completely dry before proceeding. Do not use detergent or surfactants to clean pipe surfaces.

NOTE: Refer to fitting supplier for recommended alcohol wipes.

Personal cleaning wipes may contain lanolin and/or detergent and are not suitable for use in electrofusion.

4. Without removing the fitting from its packaging, place it over the required position on the pipe. Mark the pipe surface outlining the saddle base area plus about 20 mm with a suitable marker pen to allow for visual checking of the peeled area after jointing is complete.


5. Check ovality as described above and use re-rounding tools as appropriate.
6. Use an appropriate mechanical peeling tool to remove the entire surface of the pipe over the full area marked. Mechanical peeling tools are strongly preferred, as they achieve a consistent pipe surface preparation. Hand scrapers are not mechanical peeling tools and shall not be used.
7. Metal files, rasps, emery paper, etc are not suitable peeling tools and shall not be used.
8. When jointing in high ambient temperature and in combination with direct sunlight, it is important that the pipe jointing area is shaded by an appropriate shelter. Some manufacturers fittings do not require adjustment to the heat cycle time for ambient temperatures in the range -10°C to +45°C, whereas others require heat cycle time variation to compensate for ambient temperature within this range.

7.1.2 JOINTING PROCEDURE

1. Wipe the prepared surface only with the manufacturer's approved alcohol wipe to remove any dust residue and other contaminants. For larger diameter pipes use multiple alcohol wipes.

NOTE: Cleaning of the prepared surface is a critical step and one that has the potential to introduce contaminants if not done correctly – remember this is the surface that is about to be welded and the presence of contaminants can readily result in a poorly welded joint.

ENSURE THE PREPARED SURFACES ARE COMPLETELY DRY BEFORE PROCEEDING

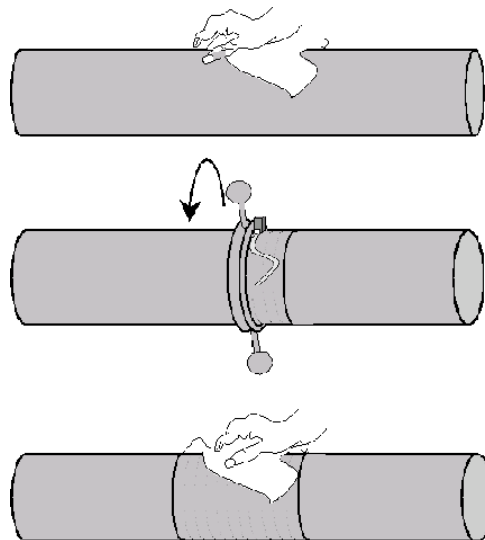


DO NOT HANDLE THE PREPARED PIPE SURFACE

2. Remove the fitting from its packaging and check that the jointing surface of the saddle fitting is clean. The bore of the fitting may be wiped with a recommended alcohol wipe if necessary.

NOTE: Ensure that the bore is completely dry before proceeding.


3. Position the fitting base onto the prepared pipe surface. Bring the lower saddle into position. Then gradually and equally tighten the bolts and nuts, following the manufacturer's instructions until the upper saddle makes firm contact with the prepared surface of the pipe. Carefully inspect the fitting to ensure a firm contact with the pipe is achieved over the entire upper saddle contact area. Install re-rounding tools if pipe out of roundness exceeds 1.5% or if a firm contact is not achieved over the entire upper saddle contact area. Refer to Section 2.1.7.2 Ovality for further details.
4. Saddles for larger main sizes may use different clamping systems, always refer to the manufacturer's instructions for guidance on the correct use of these clamps.

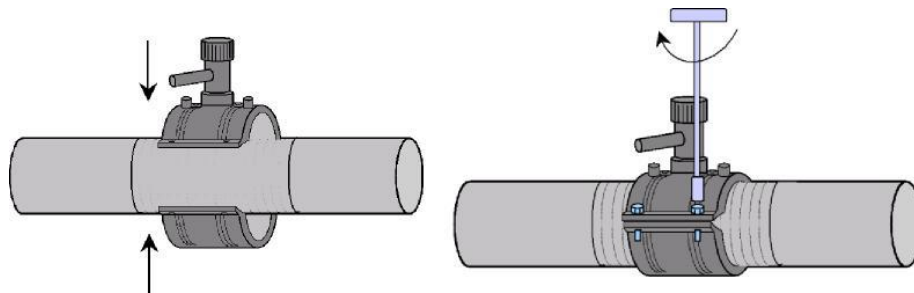

5. Check that there is sufficient fuel for the generator to complete the joint. Start the generator and check that it is functioning correctly.

NOTE: Ensure the generator is switched on and running satisfactorily before connecting the electrofusion control unit to the power source.

6. Switch on the control unit. Check that the reset button, if fitted, is in the correct mode.
7. Connect the control unit output leads to the fitting terminals and check that they have been fully inserted.

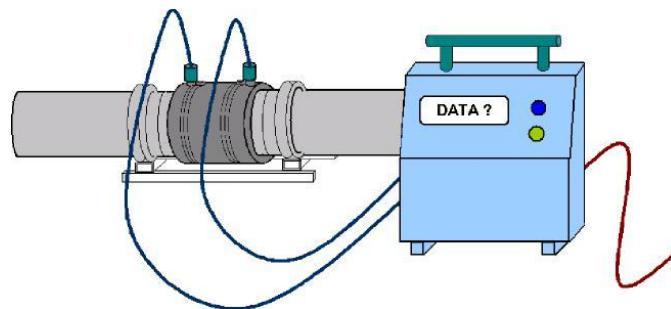

8. The jointing time is indicated either on the fitting label or on a data carrier supplied with the fitting. Check that the correct time is shown on the control unit display. If required for the control unit, enter the fusion jointing time into the control unit timer.


NOTE: Automatic control units are available which obviate the need to enter fusion time.

9. If the control unit is equipped with a barcode reader or barcode scanner, scan the fusion data barcode into the machine to ensure a fully automated and controlled data entry. Barcode reading control units automatically adjust for variable temperature conditions. For manual input of the heat fusion time into the control unit, refer to the manufacturer's or supplier's parameters, which should be supplied with the fitting.

10. Press the start button on the control unit and check that the heating cycle is proceeding as

indicated by the display.

11. On completion of the heating cycle examine the fitting and assess in accordance with Section 3 Post Weld Visual Inspection.

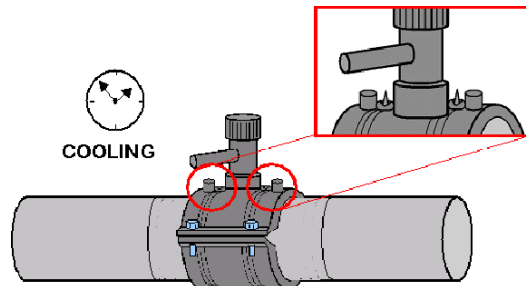


Refer to the fitting supplier or manufacturer for details on branch outlets and specific installation instructions.

12. If the fusion cycle terminates before completion, check for faults as indicated by the control unit warning lights or display. Check for a possible cause of the break, e.g., inadequate fuel in the generator, or power supply failure, etc.

NOTE: If the process terminates prematurely some fitting manufacturers permit a second fusion cycle to be performed. Other manufacturers however recommend replacement of the fitting. Hence the welder shall refer to the manufacturer's recommendations. If a second fusion cycle is permitted DO NOT attempt a second fusion cycle until the entire saddle fitting has cooled to less than 45°C.

13. The completed joint shall be left in the clamps for cooling. The time needed will be specified on the fitting label, or by its data carrier, or in the display of the automatic control unit.
14. The connection of the service pipe to the spigot outlet shall be carried out in accordance with the procedure of the appropriate section of these guidelines.

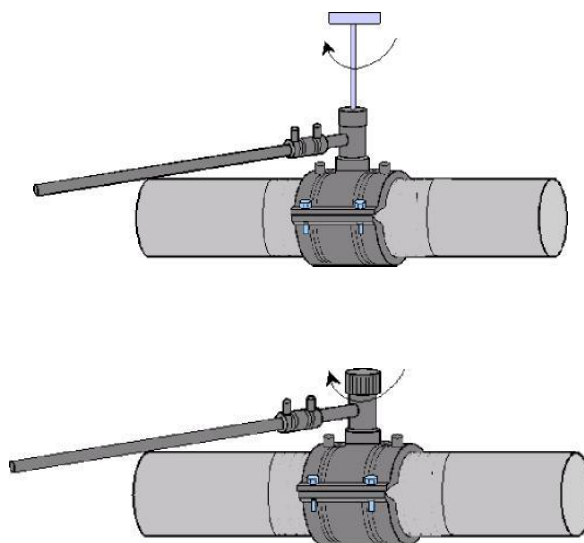

15. **DO NOT** attempt to tap the main before the completion of the required cooling cycle as specified by the supplier. Additional cooling time is recommended before tapping if the pipeline is to be field pressure tested as soon as practical – refer to manufacturer's instruction.

8. JOINTING PROCEDURE – TOP LOAD ELECTROFUSION BRANCH SADDLE

Top load electrofusion branch saddles are typically used for large diameter branch connections ≥ 90 mm. Applications include new installations, renovation, repair and under pressure live branch connections on existing PE mains for sizes to DN630 mm.

Typical installation instructions are detailed below:

1. Ensure hands and tools are free from surface contaminants, such as hand cream, sunscreen, detergent, and surfactant used in horizontal directional drilling.
2. Clean pipe in the fusion area with an approved alcohol wipe as detailed above then remove the oxidised layer with a rotary or mechanical peeler.



3. Clean pipe in the fusion zone with an approved alcohol wipe.



4. Mount the fitting to the pipe in accordance to the manufacturer's instructions using the manufacturer's top load tool. The manufacturers tools vary in the method they apply pressure to the saddle fitting – the common devices will be either mechanical, pneumatic or operate using vacuum. Regardless of the means by which pressure is applied ensure a positive contact is made between the pipe and saddle. The joint gap shall not exceed 0.5 mm.
5. Connect the terminals and apply the fusion voltage.
6. The assembled joint shall be left in the clamps during the electrofusion and manufacturer's specified cooling period. The cooling time is typically specified on the fitting label, or by its data carrier, or in the display of the automatic control unit. Any reduction in clamping pressure, during this period, can cause joint failure.



7. The core shall not be drilled until the time specified by the manufacturer. Typically, this can be as long as 4x the cooling time measured from the end of the weld cycle.

APPENDIX A

RECORD SHEETS

Record sheets shall be maintained for all equipment required for all fusion jointing operations. The sheet should be headed:

'SERVICING AND CALIBRATION RECORD SHEET'

Followed by:

**'ELECTROFUSION SOCKET EQUIPMENT /
ELECTROFUSION SADDLE EQUIPMENT'**

(Delete as appropriate)

and then the appropriate sub-title from the following list (additional record sheets may be kept if required):

Electrofusion socket jointing:

Generators

Electrofusion control unit

Electrical safety test

Electrofusion saddle jointing:

Generators

Electrofusion control unit

Electrical safety test

The information recorded on the sheet should include but not be restricted to:

- The date of servicing or maintenance.
- The name, address and telephone number of the undertaking or contractor operating the equipment.
- The name, address and telephone number of the company conducting the service or maintenance.
- The member (or members) of staff responsible for servicing or maintenance.
- The serial number of the equipment.
- The details of service and/or maintenance carried out. This should include relevant details of test equipment, procedures and/or manuals used, and relevant ambient conditions.
- The signature(s) of the member (or members) of staff responsible for the servicing or maintenance operations conducted.



PIPA

PLASTICS INDUSTRY
PIPE ASSOCIATION
OF AUSTRALIA LIMITED

PO Box 957 North Lakes Q 4509

E plasticpipe@pipa.com.au

P +61 (0) 459 919 437

pipa.com.au

Disclaimer

In formulating this guideline PIPA has relied upon the advice of its members and, where appropriate, independent testing.

Notwithstanding, users of the guidelines are advised to seek their own independent advice and, where appropriate, to conduct their own testing and assessment of matters contained in the guidelines, and to not rely solely on the guidelines in relation to any matter that may risk loss or damage.

PIPA gives no warranty concerning the correctness or accuracy of the information, opinions and recommendations contained in the guidelines. Users of the guidelines are advised that their reliance on any matter contained in the guidelines is at their own risk.